

Input: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 24/360 = 0.066$


$lab \cdot tch$ and $lab \cdot nch$

D65: hue R

LCH*Ma: 47 92 24


rgb*Ma: 1.0 0.0 0.0

triangle lightness t^*

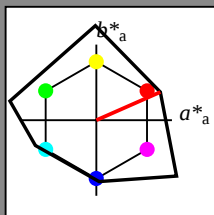

NCS11; adapted (a) CIELAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
RMa	47.15	84.64	37.25	92.48	24
JMa	91.37	-1.27	125.03	125.03	91
GMa	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
R _{CIE}	39.92	58.69	27.98	65.01	25
J _{CIE}	81.26	-2.9	71.56	71.62	92
G _{CIE}	52.23	-42.45	13.59	44.59	162
B _{CIE}	30.57	1.35	-46.48	46.51	272

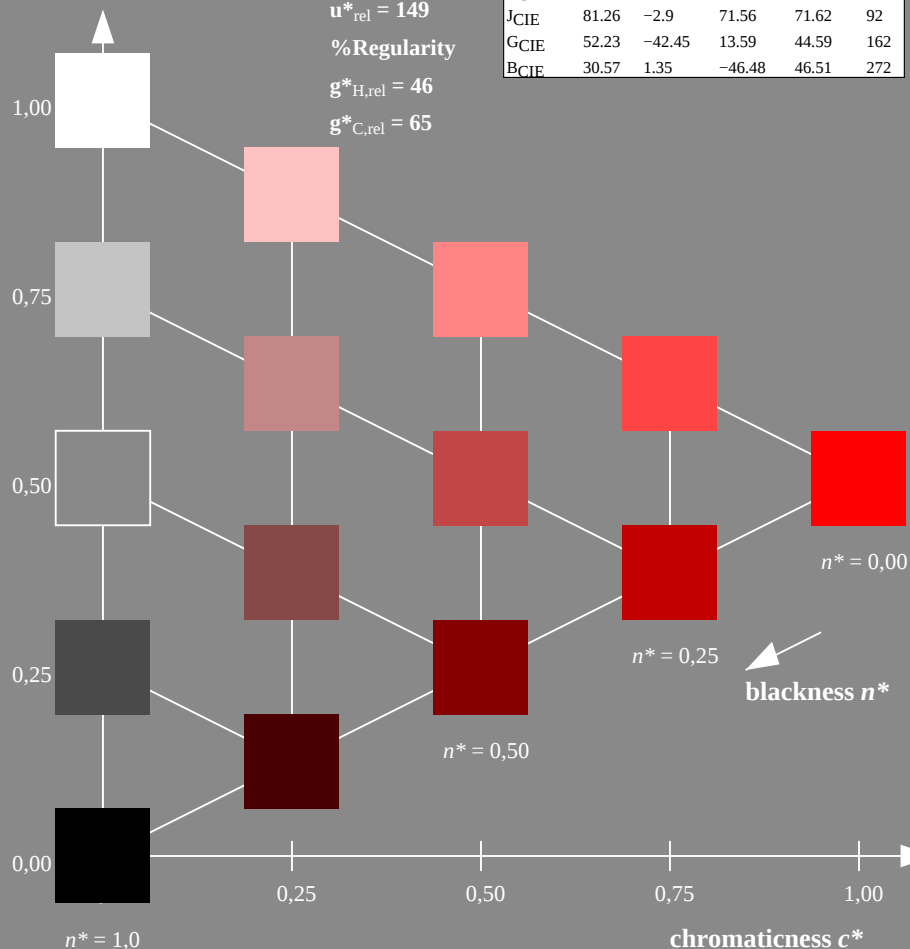

TE290-7, 5 step scales for constant CIELAB hue 24/360 = 0.066 (left)

Output: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 24/360 = 0.066$


$LAB \cdot LCH$, $LAB \cdot NCH$

D65: hue R

LCH*Ma: 47 92 24


rgb*Ma: 1.0 0.0 0.0

CIELAB lightness L^*

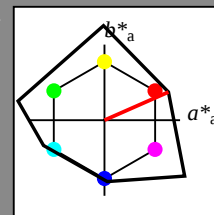

NCS11; adapted (a) CIELAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
RMa	47.15	84.64	37.25	92.48	24
JMa	91.37	-1.27	125.03	125.03	91
GMa	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
R _{CIE}	39.92	58.69	27.98	65.01	25
J _{CIE}	81.26	-2.9	71.56	71.62	92
G _{CIE}	52.23	-42.45	13.59	44.59	162
B _{CIE}	30.57	1.35	-46.48	46.51	272

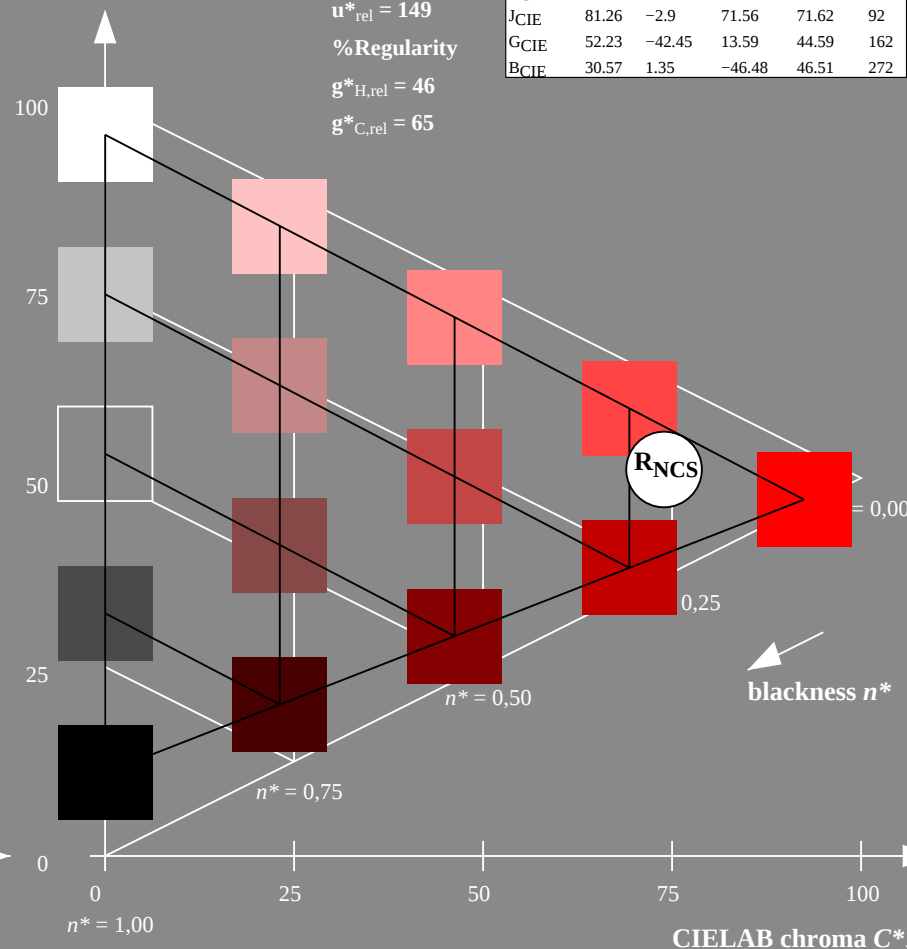

5 step scales for constant CIELAB hue 24/360 = 0.066 (right)

BAM-test chart TE29; Colorimetric systems NCS11a & NCS11a input: $olv^* \cdot setrgbcolor$

D65: Coordinate systems of 5 step colour scales for 10 hues

output: $olv^* \cdot setrgbcolor / w^* \cdot setgray$

Input: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 91/360 = 0.252$


$lab \cdot tch$ and $lab \cdot nch$

D65: hue J

LCH*Ma: 91 125 91

rgb*Ma: 1.0 1.0 0.0

triangle lightness t^*

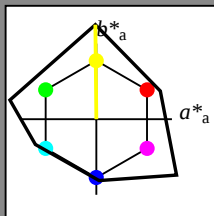

% Gamut

$u^*_{rel} = 149$


% Regularity

$g^*_{H,rel} = 46$

$g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^* = L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
RMa	47.15	84.64	37.25	92.48	24
JMa	91.37	-1.27	125.03	125.03	91
GMa	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
RCIE	39.92	58.69	27.98	65.01	25
JCIE	81.26	-2.9	71.56	71.62	92
GCIE	52.23	-42.45	13.59	44.59	162
BCIE	30.57	1.35	-46.48	46.51	272

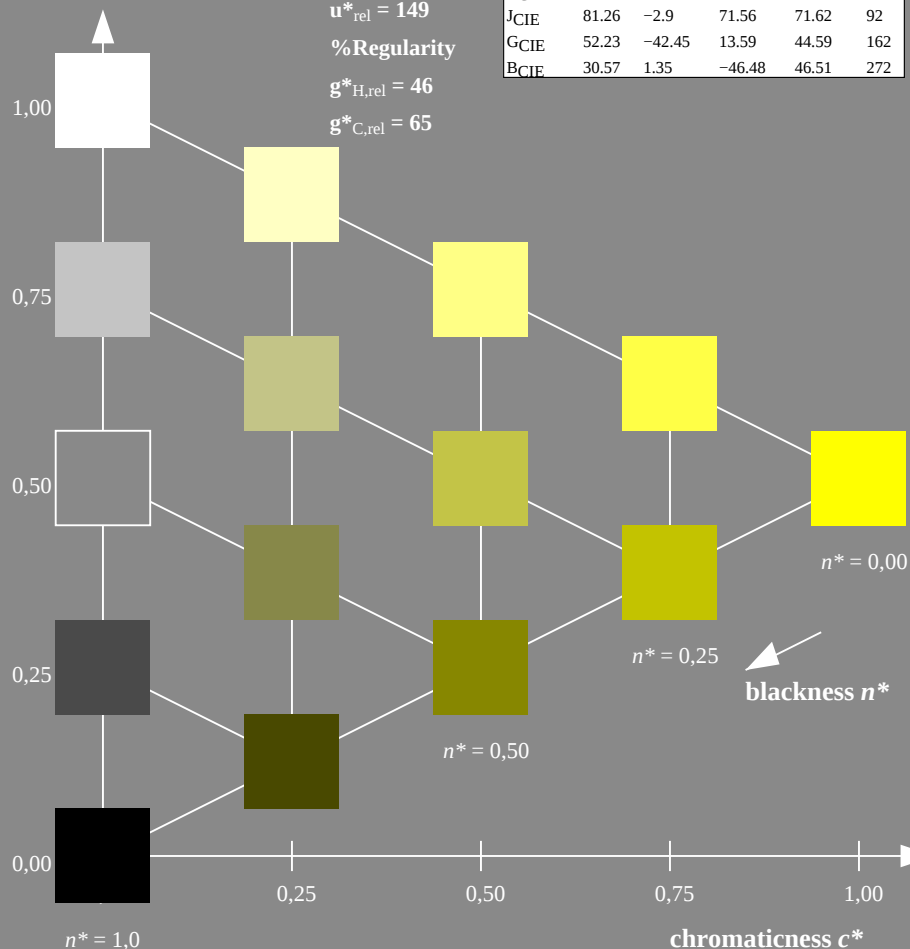

TE290-7, 5 step scales for constant CIELAB hue 91/360 = 0.252 (left)

Output: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 91/360 = 0.252$


$LAB \cdot LCH$, $LAB \cdot NCH$

D65: hue J

LCH*Ma: 91 125 91

rgb*Ma: 1.0 1.0 0.0

CIELAB lightness L^*

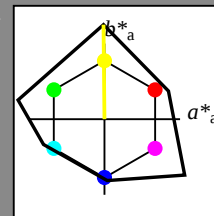

% Gamut

$u^*_{rel} = 149$


% Regularity

$g^*_{H,rel} = 46$

$g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^* = L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
RMa	47.15	84.64	37.25	92.48	24
JMa	91.37	-1.27	125.03	125.03	91
GMa	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
RCIE	39.92	58.69	27.98	65.01	25
JCIE	81.26	-2.9	71.56	71.62	92
GCIE	52.23	-42.45	13.59	44.59	162
BCIE	30.57	1.35	-46.48	46.51	272

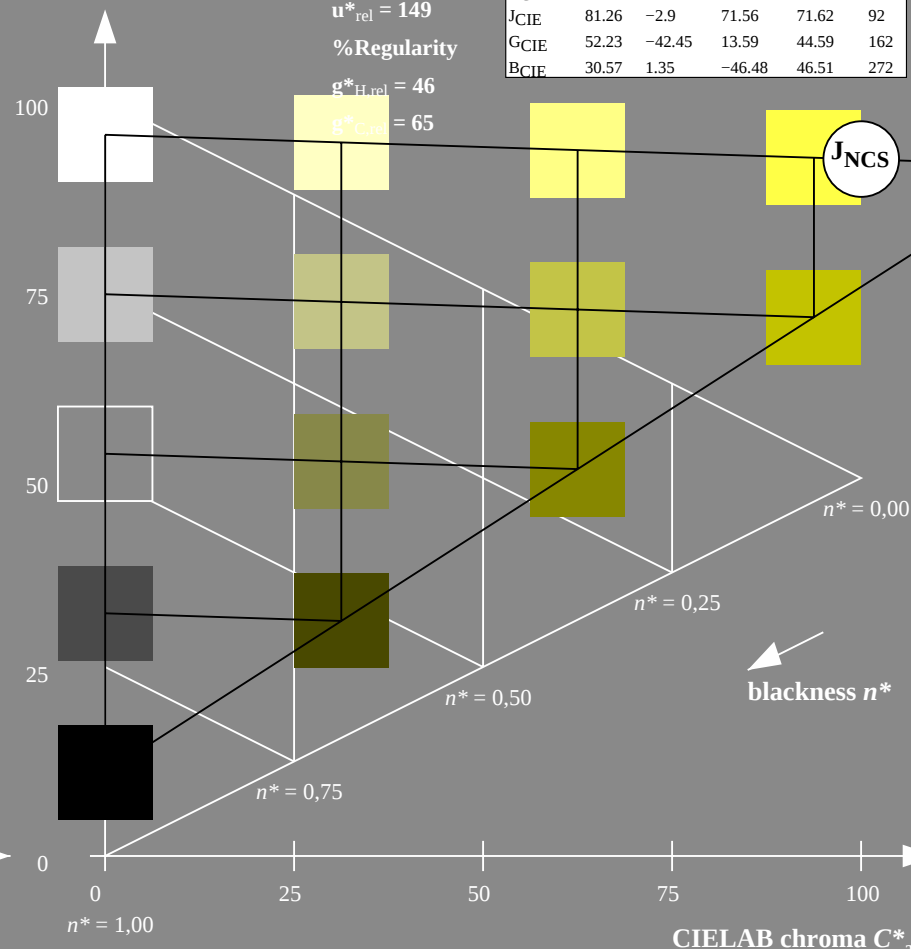

5 step scales for constant CIELAB hue 91/360 = 0.252 (right)

BAM-test chart TE29; Colorimetric systems NCS11a & NCS11a input: $olv^* \cdot setrgbcolor$

D65: Coordinate systems of 5 step colour scales for 10 hues

output: $olv^* \cdot setrgbcolor / w^* \cdot setgray$

Input: Colorimetric Reflective System NCS11

for hue $h^* = lab^*h = 167/360 = 0.465$


lab^*tch and lab^*nch

D65: hue G

LCH*Ma: 63 117 167

rgb*Ma: 0.0 1.0 0.0

triangle lightness t^*

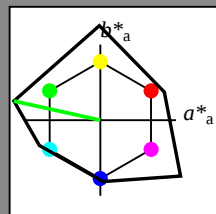

% Gamut

$u^*_{rel} = 149$


% Regularity

$g^*_{H,rel} = 46$

$g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
RMa	47.15	84.64	37.25	92.48	24
JMa	91.37	-1.27	125.03	125.03	91
GMa	63.07	-114.28	25.35	117.06	167
G50BMa	59.47	-80.6	-33.45	87.28	203
BMa	49.01	3.65	-81.19	81.28	273
B50RMa	44.06	106.09	-73.93	129.32	325
NMa	10.99	0.0	0.0	0.0	0
WMa	95.41	0.0	0.0	0.0	0
RCIE	39.92	58.69	27.98	65.01	25
JCIE	81.26	-2.9	71.56	71.62	92
GCIE	52.23	-42.45	13.59	44.59	162
BCIE	30.57	1.35	-46.48	46.51	272

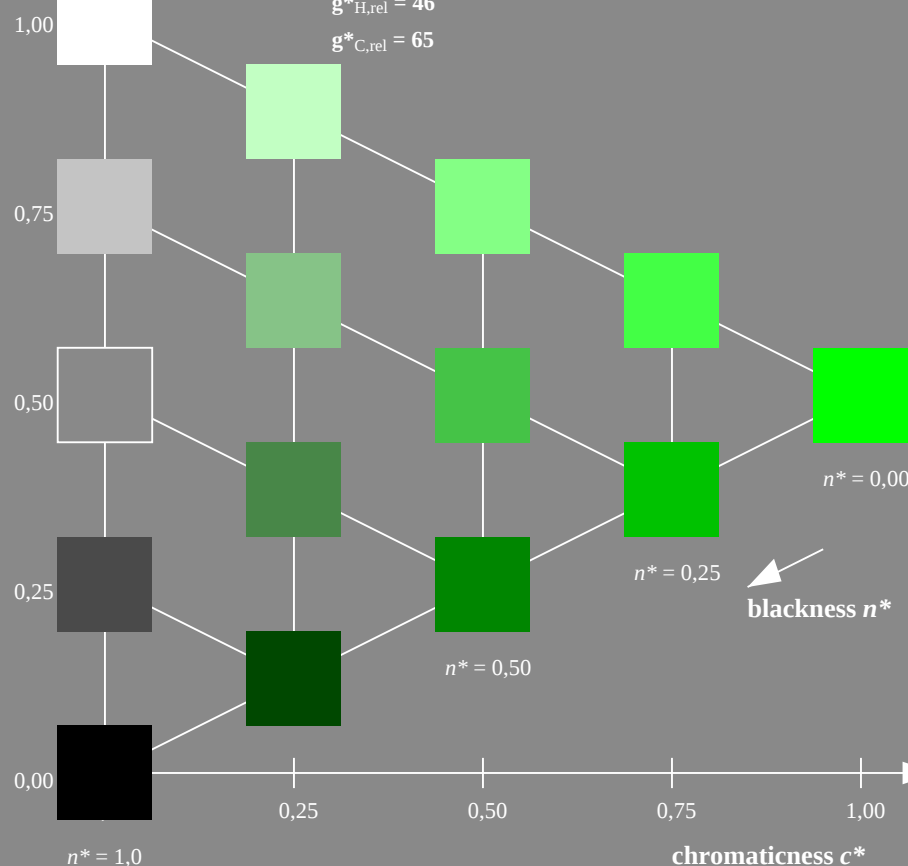

TE290-7, 5 step scales for constant CIELAB hue 167/360 = 0.465 (left)

Output: Colorimetric Reflective System NCS11

for hue $h^* = lab^*h = 167/360 = 0.465$


LAB^*LCH , LAB^*NCH

D65: hue G

LCH*Ma: 63 117 167

rgb*Ma: 0.0 1.0 0.0

CIELAB lightness L^*

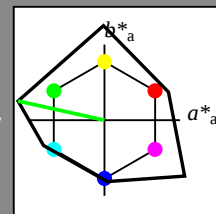

% Gamut

$u^*_{rel} = 149$


% Regularity

$g^*_{H,rel} = 46$

$g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
RMa	47.15	84.64	37.25	92.48	24
JMa	91.37	-1.27	125.03	125.03	91
GMa	63.07	-114.28	25.35	117.06	167
G50BMa	59.47	-80.6	-33.45	87.28	203
BMa	49.01	3.65	-81.19	81.28	273
B50RMa	44.06	106.09	-73.93	129.32	325
NMa	10.99	0.0	0.0	0.0	0
WMa	95.41	0.0	0.0	0.0	0
RCIE	39.92	58.69	27.98	65.01	25
JCIE	81.26	-2.9	71.56	71.62	92
GCIE	52.23	-42.45	13.59	44.59	162
BCIE	30.57	1.35	-46.48	46.51	272

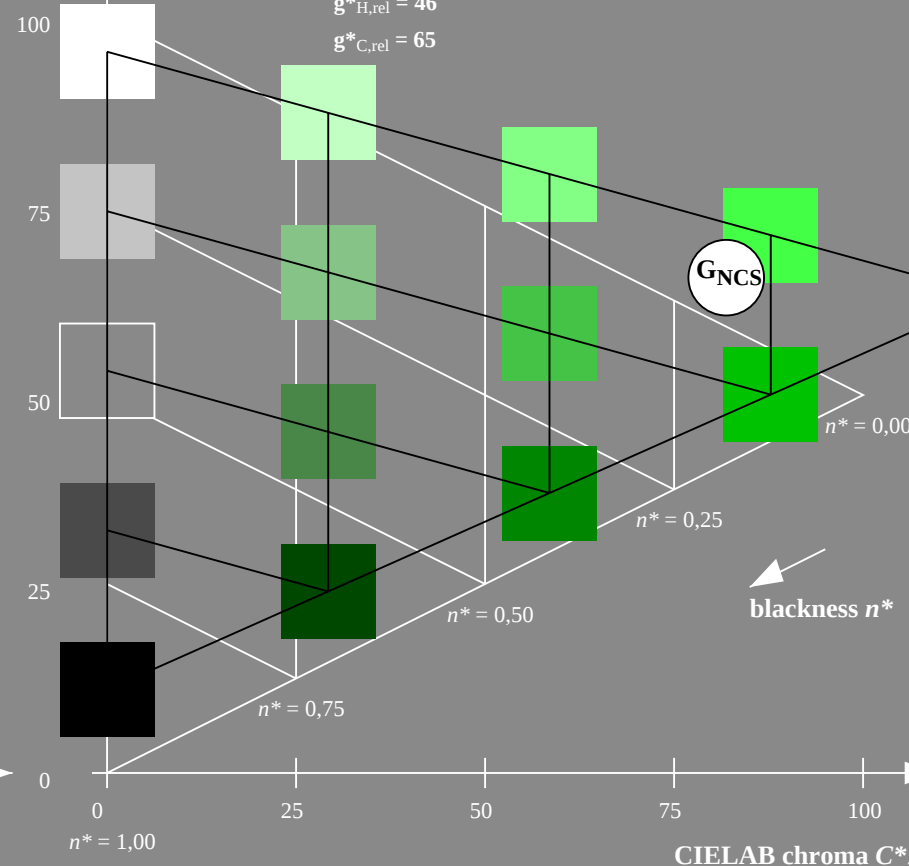

5 step scales for constant CIELAB hue 167/360 = 0.465 (right)

BAM-test chart TE29; Colorimetric systems NCS11a & NCS11a input: $olv^*setrgbcolor$

D65: Coordinate systems of 5 step colour scales for 10 hues

output: $olv^*setrgbcolor / w^*setgray$

Input: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 203/360 = 0.563$


$lab \cdot tch$ and $lab \cdot nch$

D65: hue G50B

LCH*Ma: 59 87 203

rgb*Ma: 0.0 1.0 1.0

triangle lightness t^*

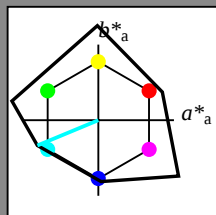

% Gamut

$u^*_{rel} = 149$


% Regularity

$g^*_{H,rel} = 46$

$g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
RMa	47.15	84.64	37.25	92.48	24
JMa	91.37	-1.27	125.03	125.03	91
GMa	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
RCIE	39.92	58.69	27.98	65.01	25
JCIE	81.26	-2.9	71.56	71.62	92
GCIE	52.23	-42.45	13.59	44.59	162
BCIE	30.57	1.35	-46.48	46.51	272

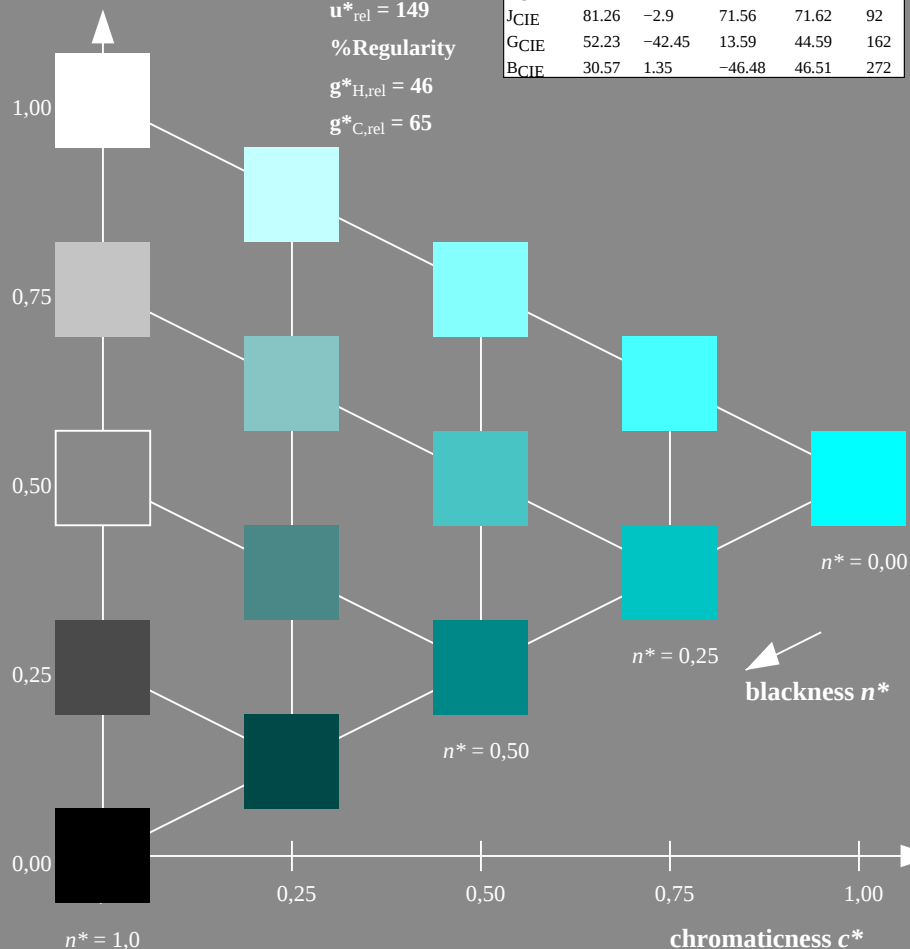

TE290-7, 5 step scales for constant CIELAB hue 203/360 = 0.563 (left)

Output: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 203/360 = 0.563$


$LAB \cdot LCH$, $LAB \cdot NCH$

D65: hue G50B

LCH*Ma: 59 87 203

rgb*Ma: 0.0 1.0 1.0

CIELAB lightness L^*

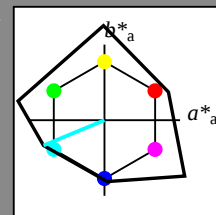

% Gamut

$u^*_{rel} = 149$


% Regularity

$g^*_{H,rel} = 46$

$g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
RMa	47.15	84.64	37.25	92.48	24
JMa	91.37	-1.27	125.03	125.03	91
GMa	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
RCIE	39.92	58.69	27.98	65.01	25
JCIE	81.26	-2.9	71.56	71.62	92
GCIE	52.23	-42.45	13.59	44.59	162
BCIE	30.57	1.35	-46.48	46.51	272

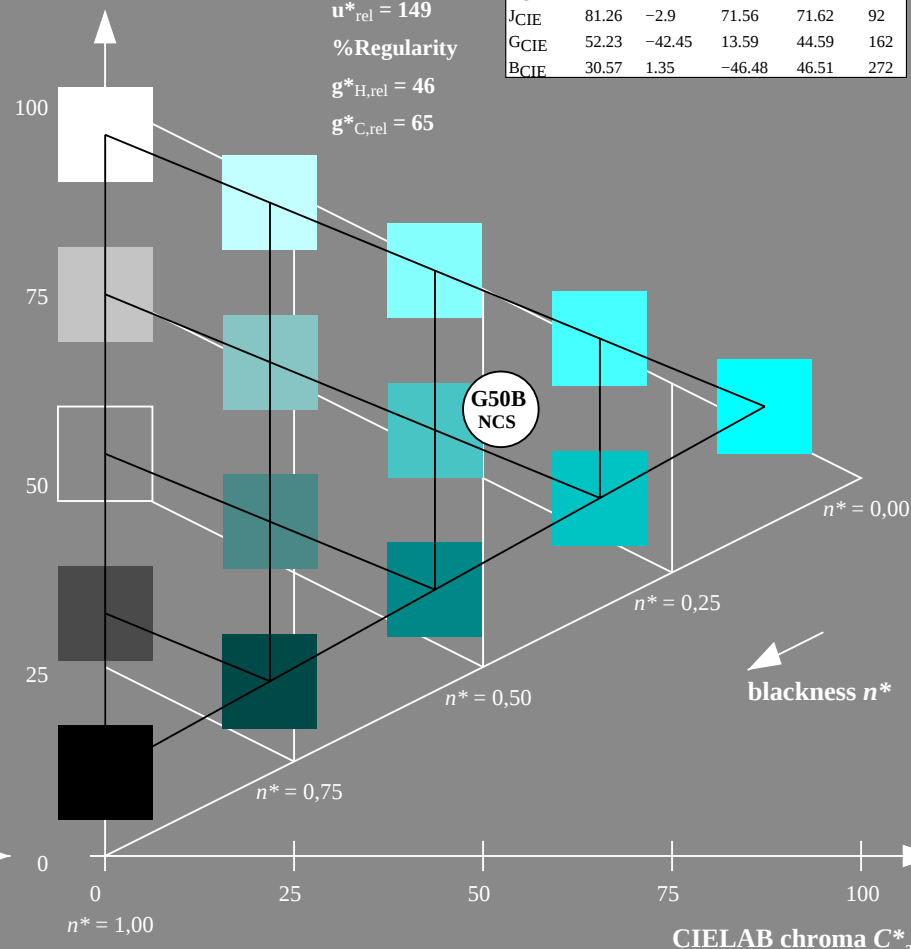

5 step scales for constant CIELAB hue 203/360 = 0.563 (right)

BAM-test chart TE29; Colorimetric systems NCS11a & NCS11a input: $olv^* \cdot setrgbcolor$

D65: Coordinate systems of 5 step colour scales for 10 hues

output: $olv^* \cdot setrgbcolor / w^* \cdot setgray$

Input: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 273/360 = 0.757$


$lab \cdot tch$ and $lab \cdot nch$

D65: hue B

LCH*Ma: 49 81 273

rgb*Ma: 0.0 0.0 1.0

triangle lightness t^*

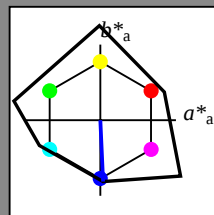

% Gamut

$u^*_{rel} = 149$


% Regularity

$g^*_{H,rel} = 46$

$g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
RMa	47.15	84.64	37.25	92.48	24
JMa	91.37	-1.27	125.03	125.03	91
GMa	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
RCIE	39.92	58.69	27.98	65.01	25
JCIE	81.26	-2.9	71.56	71.62	92
GCIE	52.23	-42.45	13.59	44.59	162
BCIE	30.57	1.35	-46.48	46.51	272

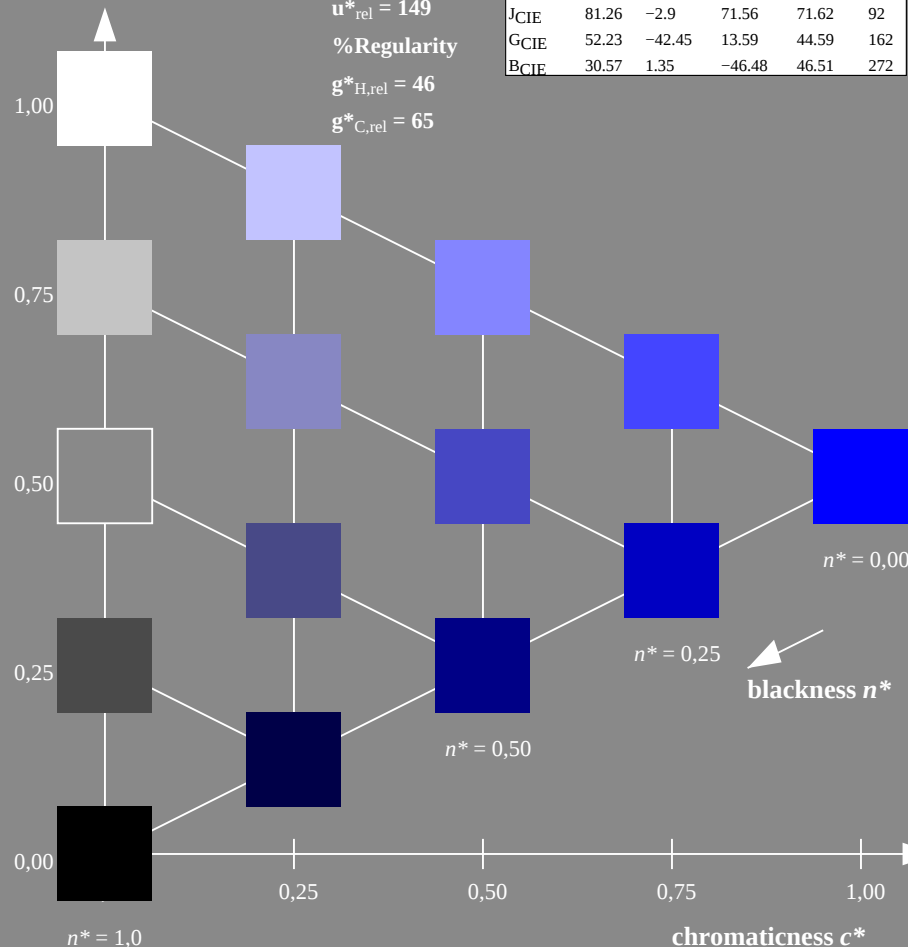

TE290-7, 5 step scales for constant CIELAB hue 273/360 = 0.757 (left)

Output: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 273/360 = 0.757$


$LAB \cdot LCH$, $LAB \cdot NCH$

D65: hue B

LCH*Ma: 49 81 273

rgb*Ma: 0.0 0.0 1.0

CIELAB lightness L^*

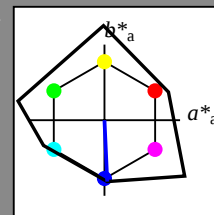

% Gamut

$u^*_{rel} = 149$


% Regularity

$g^*_{H,rel} = 46$

$g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
RMa	47.15	84.64	37.25	92.48	24
JMa	91.37	-1.27	125.03	125.03	91
GMa	63.07	-114.28	25.35	117.06	167
G50B _{Ma}	59.47	-80.6	-33.45	87.28	203
B _{Ma}	49.01	3.65	-81.19	81.28	273
B50R _{Ma}	44.06	106.09	-73.93	129.32	325
N _{Ma}	10.99	0.0	0.0	0.0	0
W _{Ma}	95.41	0.0	0.0	0.0	0
RCIE	39.92	58.69	27.98	65.01	25
JCIE	81.26	-2.9	71.56	71.62	92
GCIE	52.23	-42.45	13.59	44.59	162
BCIE	30.57	1.35	-46.48	46.51	272

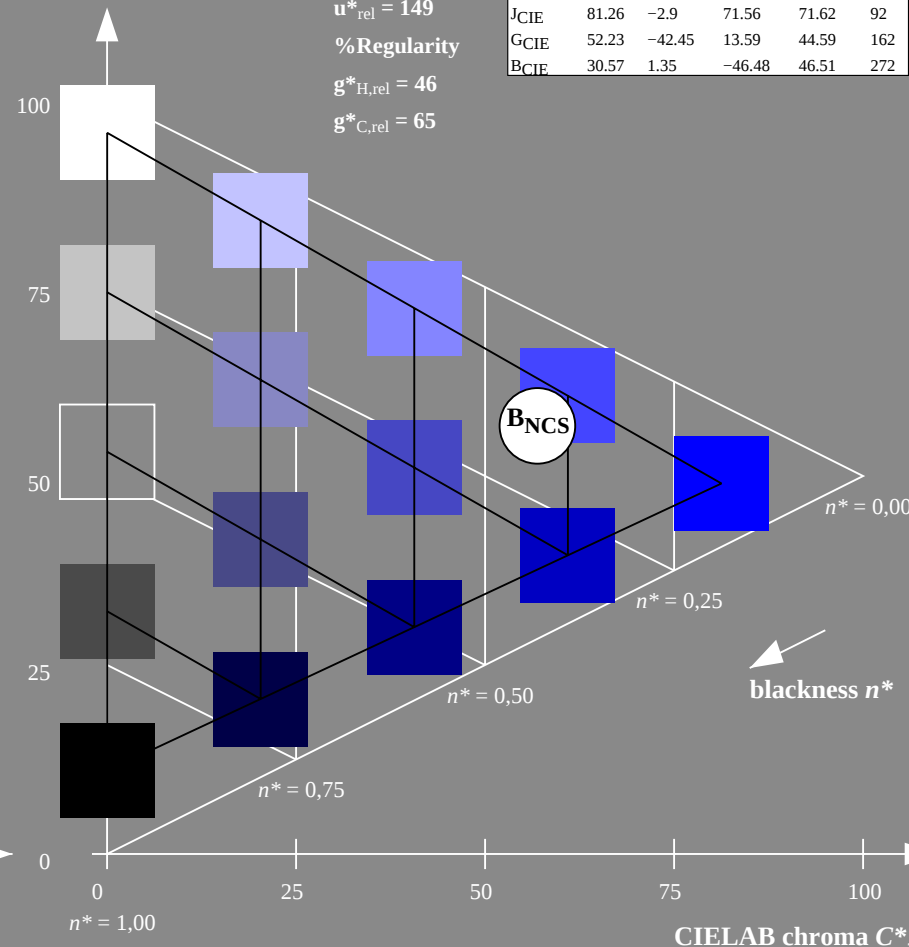

5 step scales for constant CIELAB hue 273/360 = 0.757 (right)

BAM-test chart TE29; Colorimetric systems NCS11a & NCS11a input: $olv^* \cdot setrgbcolor$

D65: Coordinate systems of 5 step colour scales for 10 hues

output: $olv^* \cdot setrgbcolor / w^* \cdot setgray$



Input: Colorimetric Reflective System NCS11


for hue $h^* = lab \cdot h = 325/360 = 0.903$

$lab \cdot tch$ and $lab \cdot nch$

D65: hue B50R

LCH*Ma: 44 129 325

rgb*Ma: 1.0 0.0 1.0

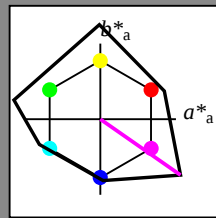

% Gamut


$u^*_{rel} = 149$

% Regularity

$g^*_{H,rel} = 46$

$g^*_{C,rel} = 65$

triangle lightness t^*

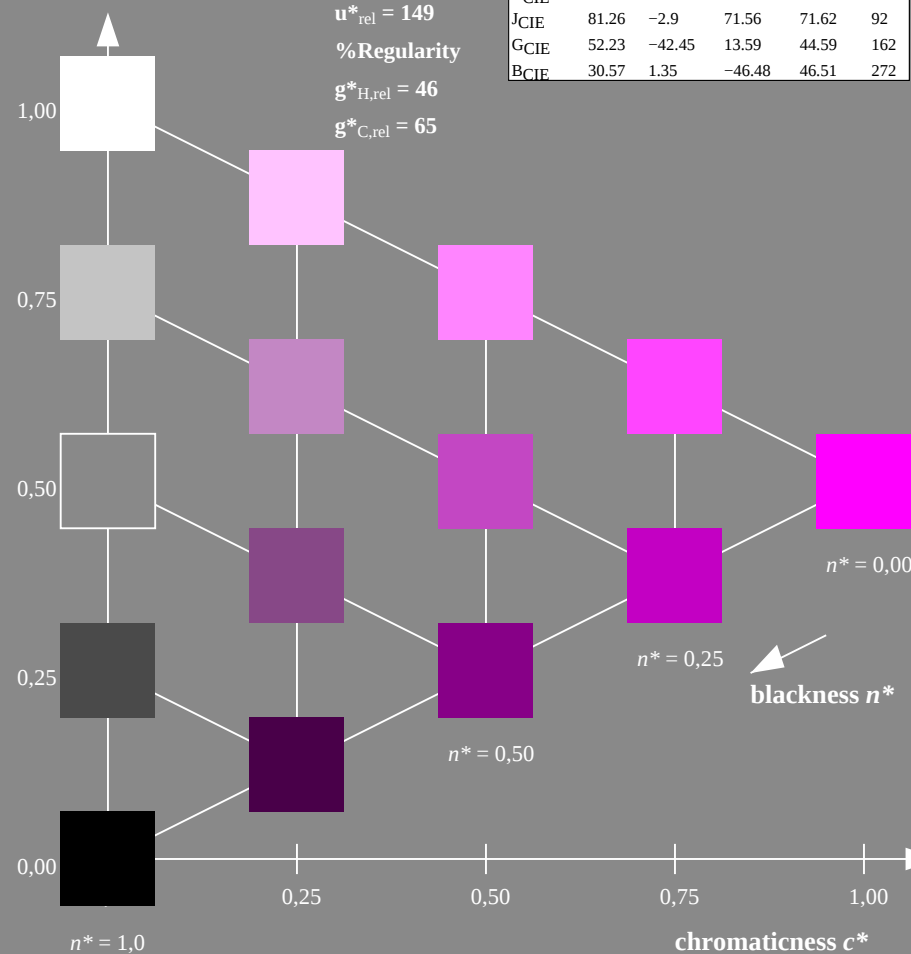

TE290-7, 5 step scales for constant CIE LAB hue 325/360 = 0.903 (left)



BAM-test chart TE29; Colorimetric systems NCS11a & NCS11a input: $olv^* setrgbcolor$

D65: Coordinate systems of 5 step colour scales for 10 hues

Output: Colorimetric Reflective System NCS11


for hue $h^* = lab \cdot h = 325/360 = 0.903$

$LAB \cdot LCH$, $LAB \cdot NCH$

D65: hue B50R

LCH*Ma: 44 129 325

rgb*Ma: 1.0 0.0 1.0

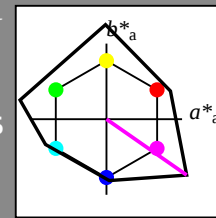

% Gamut


$u^*_{rel} = 149$

% Regularity

$g^*_{H,rel} = 46$

$g^*_{C,rel} = 65$

CIE LAB lightness L^*

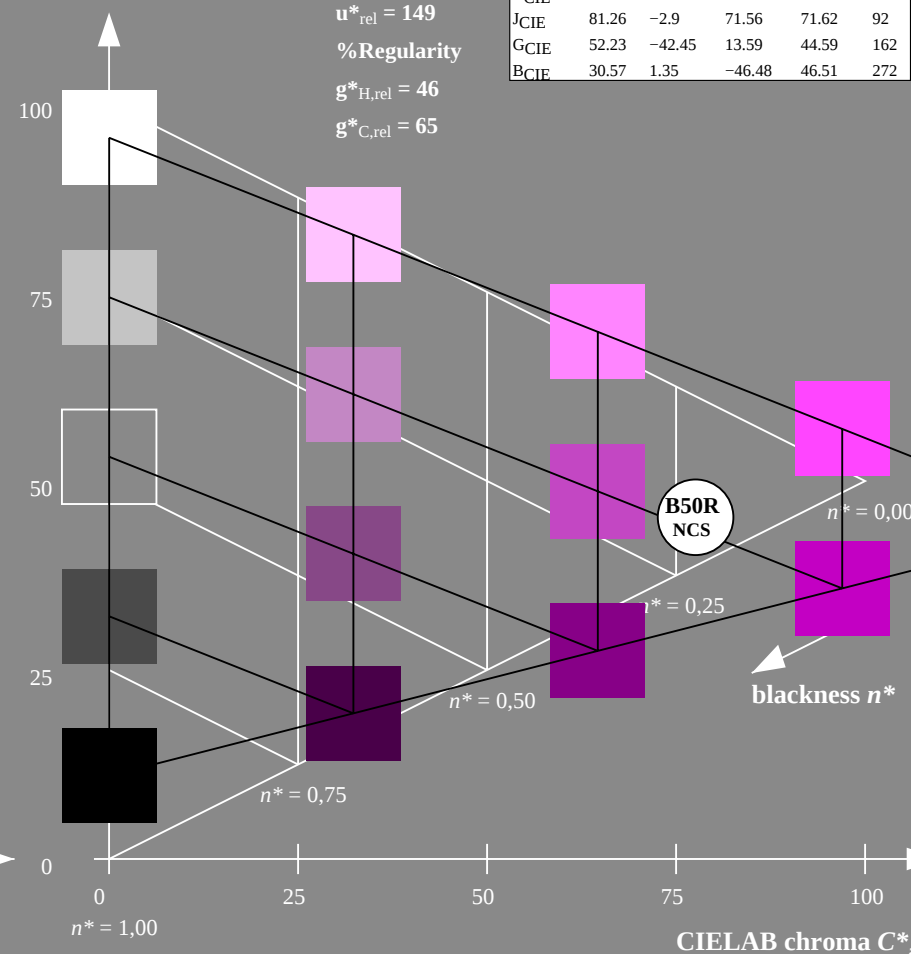

5 step scales for constant CIE LAB hue 325/360 = 0.903 (right)



output: $olv^* setrgbcolor / w^* setgray$

Input: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 25/360 = 0.071$


$lab \cdot tch$ and $lab \cdot nch$

D65: hue R

LCH*Ma: 48 91 25

rgb*Ma: 1.0 0.02 0.0

triangle lightness t^*

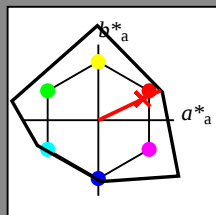

% Gamut

$u^*_{rel} = 149$


% Regularity

$g^*_{H,rel} = 46$

$g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
RMa	47.15	84.64	37.25	92.48	24
JMa	91.37	-1.27	125.03	125.03	91
GMa	63.07	-114.28	25.35	117.06	167
G50BMa	59.47	-80.6	-33.45	87.28	203
BMa	49.01	3.65	-81.19	81.28	273
B50RMa	44.06	106.09	-73.93	129.32	325
NMa	10.99	0.0	0.0	0.0	0
WMa	95.41	0.0	0.0	0.0	0
WCIE	39.92	58.69	27.98	65.01	25
JCIE	81.26	-2.9	71.56	71.62	92
GCIE	52.23	-42.45	13.59	44.59	162
BCIE	30.57	1.35	-46.48	46.51	272

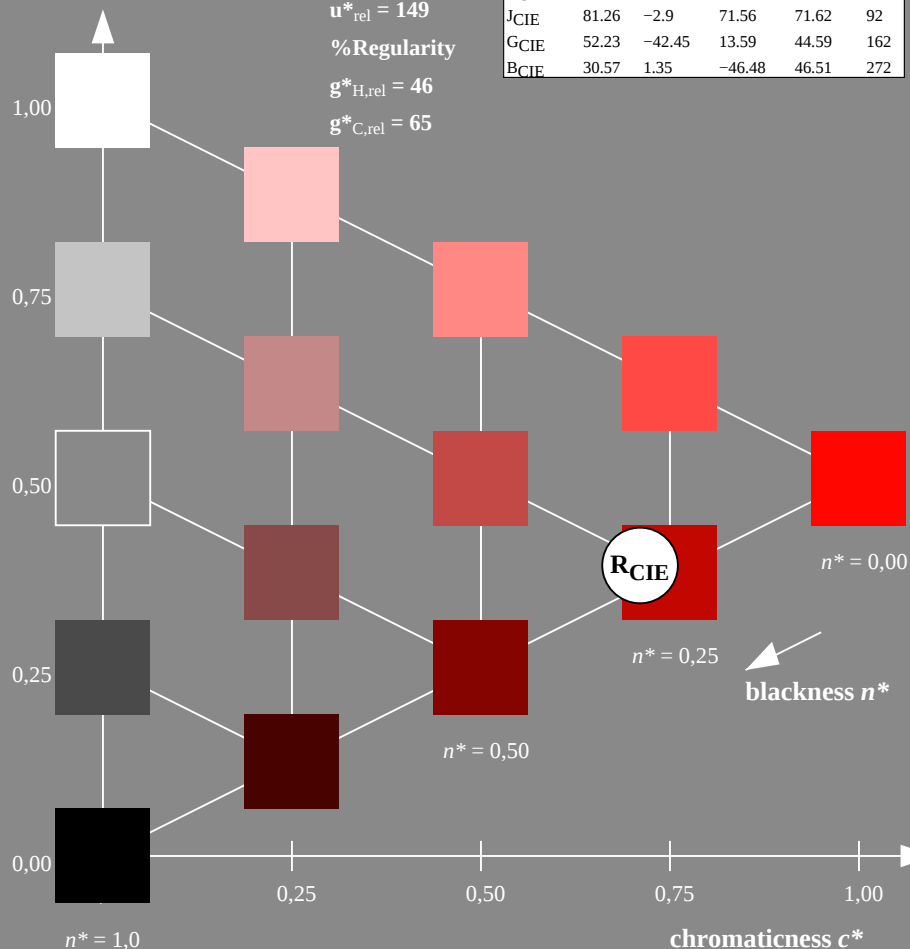

TE290-7, 5 step scales for constant CIELAB hue 25/360 = 0.071 (left)

Output: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 25/360 = 0.071$


$LAB \cdot LCH$, $LAB \cdot NCH$

D65: hue R

LCH*Ma: 48 91 25

rgb*Ma: 1.0 0.02 0.0

CIELAB lightness L^*

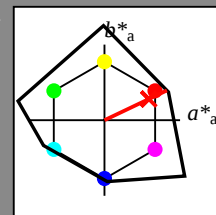

% Gamut

$u^*_{rel} = 149$


% Regularity

$g^*_{H,rel} = 46$

$g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^*=L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
RMa	47.15	84.64	37.25	92.48	24
JMa	91.37	-1.27	125.03	125.03	91
GMa	63.07	-114.28	25.35	117.06	167
G50BMa	59.47	-80.6	-33.45	87.28	203
BMa	49.01	3.65	-81.19	81.28	273
B50RMa	44.06	106.09	-73.93	129.32	325
NMa	10.99	0.0	0.0	0.0	0
WMa	95.41	0.0	0.0	0.0	0
WCIE	39.92	58.69	27.98	65.01	25
JCIE	81.26	-2.9	71.56	71.62	92
GCIE	52.23	-42.45	13.59	44.59	162
BCIE	30.57	1.35	-46.48	46.51	272

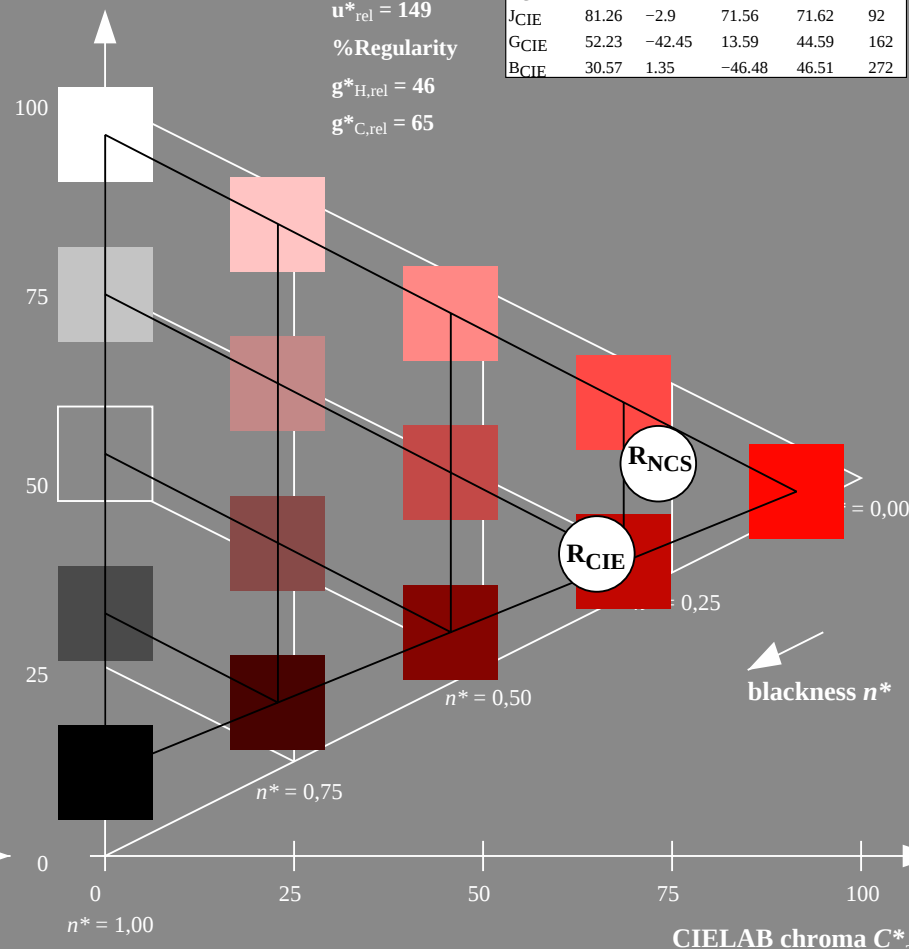

5 step scales for constant CIELAB hue 25/360 = 0.071 (right)

BAM-test chart TE29; Colorimetric systems NCS11a & NCS11a input: $olv^* \cdot setrgbcolor$

D65: Coordinate systems of 5 step colour scales for 10 hues

output: $olv^* \cdot setrgbcolor / w^* \cdot setgray$

Input: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 92/360 = 0.256$


$lab \cdot tch$ and $lab \cdot nch$

D65: hue J

LCH*Ma: 90 122 92

rgb*Ma: 0.97 1.0 0.0

triangle lightness t^*

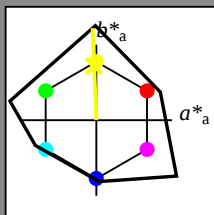

% Gamut

$u^*_{rel} = 149$


% Regularity

$g^*_{H,rel} = 46$

$g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^* = L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
RMa	47.15	84.64	37.25	92.48	24
JMa	91.37	-1.27	125.03	125.03	91
GMa	63.07	-114.28	25.35	117.06	167
G50BMa	59.47	-80.6	-33.45	87.28	203
BMa	49.01	3.65	-81.19	81.28	273
B50RMa	44.06	106.09	-73.93	129.32	325
NMa	10.99	0.0	0.0	0.0	0
WMa	95.41	0.0	0.0	0.0	0
RCIE	39.92	58.69	27.98	65.01	25
JCIE	81.26	-2.9	71.56	71.62	92
GCIE	52.23	-42.45	13.59	44.59	162
BCIE	30.57	1.35	-46.48	46.51	272

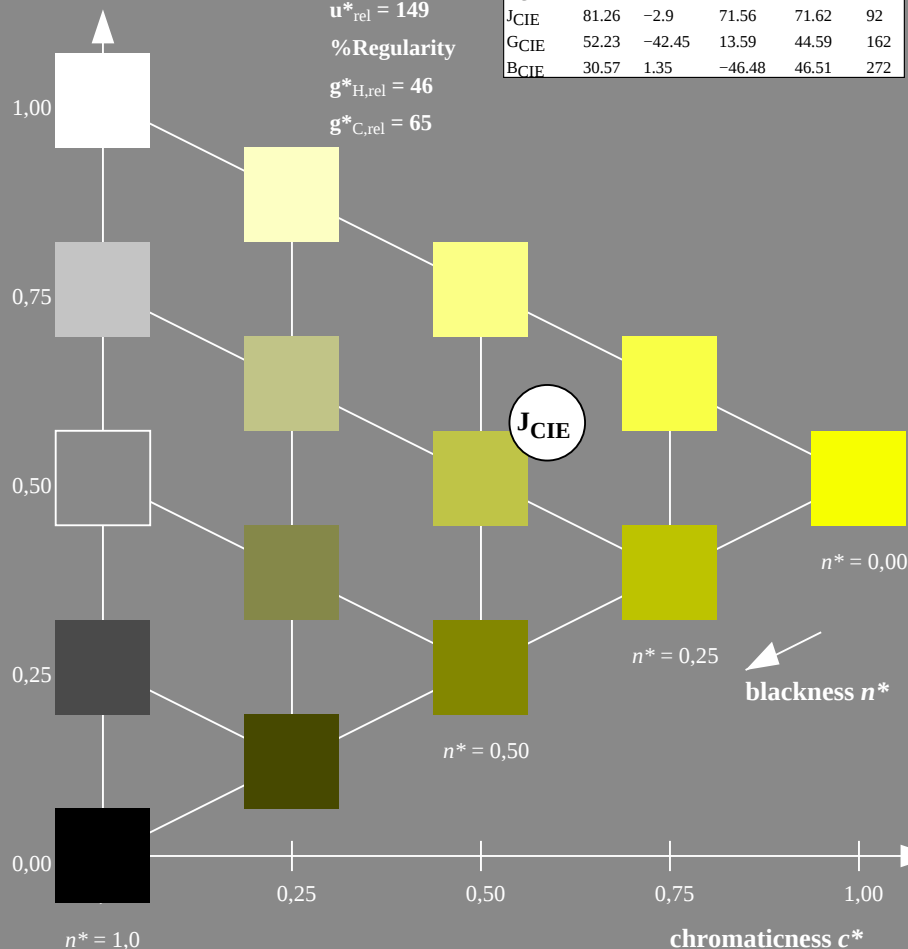

TE290-7, 5 step scales for constant CIELAB hue 92/360 = 0.256 (left)

Output: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 92/360 = 0.256$


$LAB \cdot LCH$, $LAB \cdot NCH$

D65: hue J

LCH*Ma: 90 122 92

rgb*Ma: 0.97 1.0 0.0

CIELAB lightness L^*

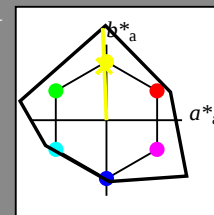

% Gamut

$u^*_{rel} = 149$


% Regularity

$g^*_{H,rel} = 46$

$g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^* = L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
RMa	47.15	84.64	37.25	92.48	24
JMa	91.37	-1.27	125.03	125.03	91
GMa	63.07	-114.28	25.35	117.06	167
G50BMa	59.47	-80.6	-33.45	87.28	203
BMa	49.01	3.65	-81.19	81.28	273
B50RMa	44.06	106.09	-73.93	129.32	325
NMa	10.99	0.0	0.0	0.0	0
WMa	95.41	0.0	0.0	0.0	0
RCIE	39.92	58.69	27.98	65.01	25
JCIE	81.26	-2.9	71.56	71.62	92
GCIE	52.23	-42.45	13.59	44.59	162
BCIE	30.57	1.35	-46.48	46.51	272

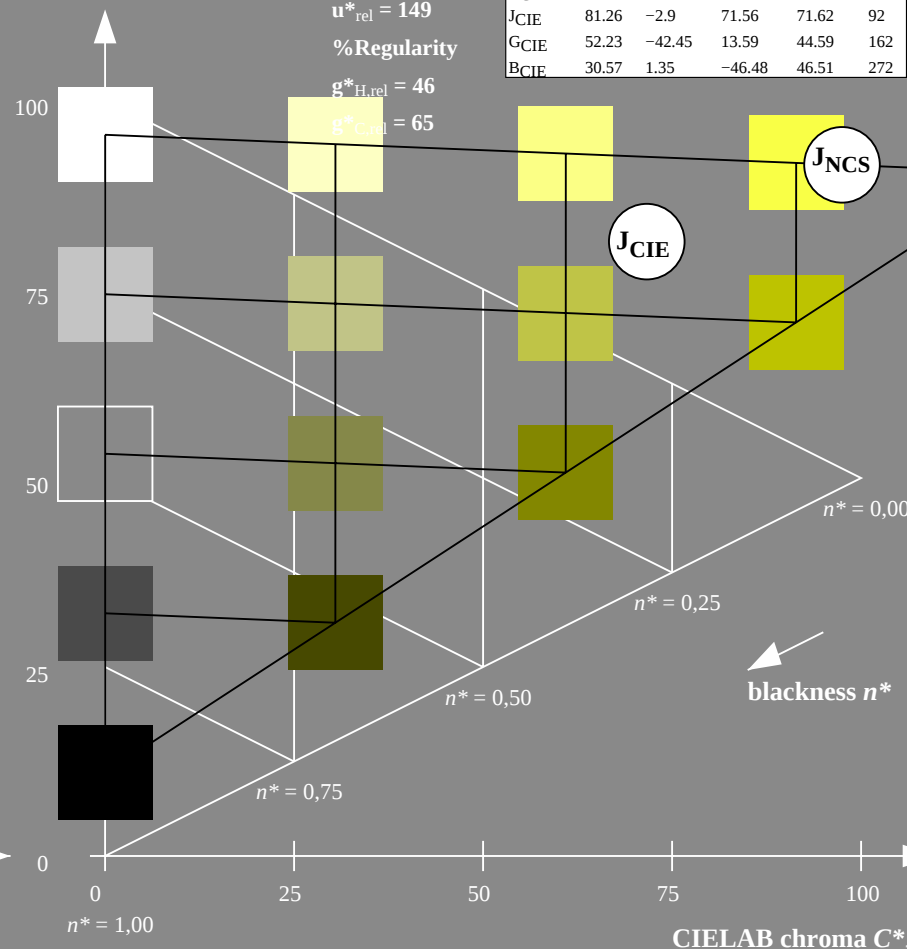

5 step scales for constant CIELAB hue 92/360 = 0.256 (right)

BAM-test chart TE29; Colorimetric systems NCS11a & NCS11a input: $olv^* \cdot setrgbcolor$

D65: Coordinate systems of 5 step colour scales for 10 hues

output: $olv^* \cdot setrgbcolor / w^* \cdot setgray$

Input: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 162/360 = 0.451$


$lab \cdot tch$ and $lab \cdot nch$

D65: hue G

LCH*Ma: 65 110 162

rgb*Ma: 0.08 1.0 0.0

triangle lightness t^*

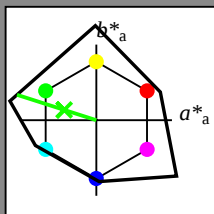

% Gamut

$u^*_{rel} = 149$


% Regularity

$g^*_{H,rel} = 46$

$g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^* = L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
RMa	47.15	84.64	37.25	92.48	24
JMa	91.37	-1.27	125.03	125.03	91
GMa	63.07	-114.28	25.35	117.06	167
G50BMa	59.47	-80.6	-33.45	87.28	203
BMa	49.01	3.65	-81.19	81.28	273
B50RMa	44.06	106.09	-73.93	129.32	325
NMa	10.99	0.0	0.0	0.0	0
WMa	95.41	0.0	0.0	0.0	0
RCIE	39.92	58.69	27.98	65.01	25
JCIE	81.26	-2.9	71.56	71.62	92
GCIE	52.23	-42.45	13.59	44.59	162
BCIE	30.57	1.35	-46.48	46.51	272

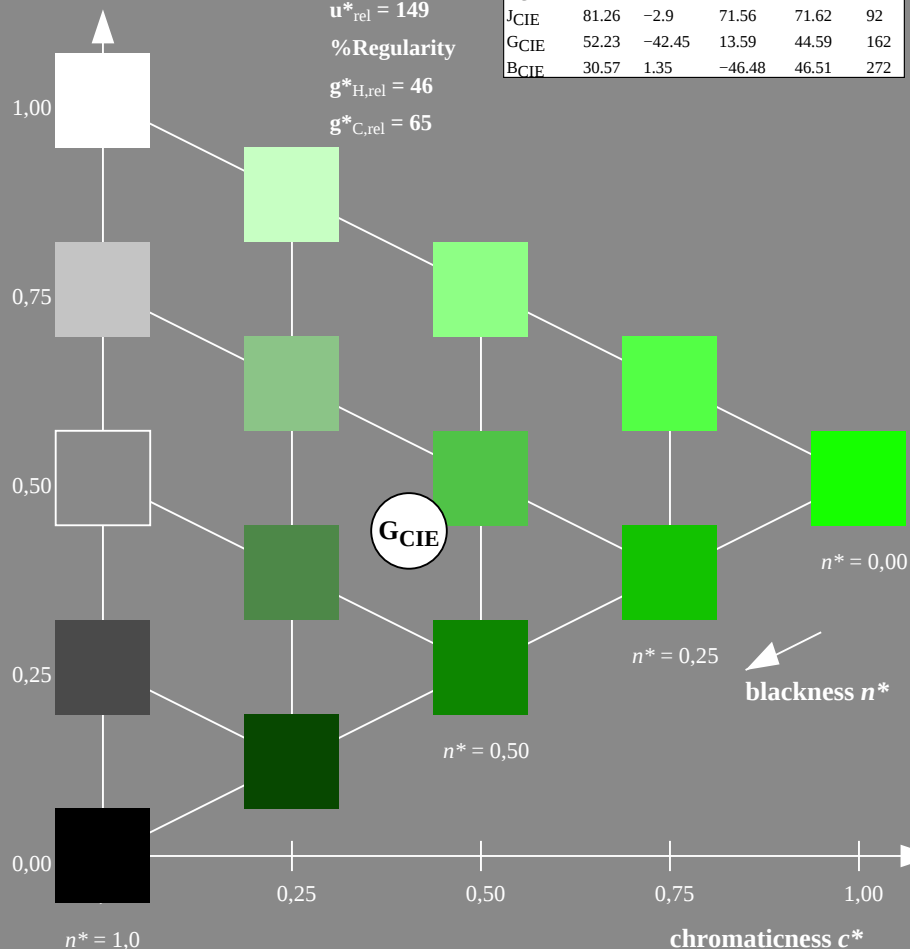

TE290-7, 5 step scales for constant CIELAB hue 162/360 = 0.451 (left)

Output: Colorimetric Reflective System NCS11

for hue $h^* = lab \cdot h = 162/360 = 0.451$


$LAB \cdot LCH$, $LAB \cdot NCH$

D65: hue G

LCH*Ma: 65 110 162

rgb*Ma: 0.08 1.0 0.0

CIELAB lightness L^*

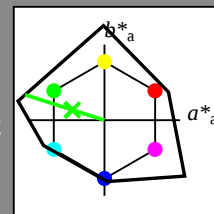

% Gamut

$u^*_{rel} = 149$


% Regularity

$g^*_{H,rel} = 46$

$g^*_{C,rel} = 65$

NCS11; adapted (a) CIELAB data

	$L^* = L^*_a$	a^*_a	b^*_a	$C^*_{ab,a}$	$h^*_{ab,a}$
RMa	47.15	84.64	37.25	92.48	24
JMa	91.37	-1.27	125.03	125.03	91
GMa	63.07	-114.28	25.35	117.06	167
G50BMa	59.47	-80.6	-33.45	87.28	203
BMa	49.01	3.65	-81.19	81.28	273
B50RMa	44.06	106.09	-73.93	129.32	325
NMa	10.99	0.0	0.0	0.0	0
WMa	95.41	0.0	0.0	0.0	0
RCIE	39.92	58.69	27.98	65.01	25
JCIE	81.26	-2.9	71.56	71.62	92
GCIE	52.23	-42.45	13.59	44.59	162
BCIE	30.57	1.35	-46.48	46.51	272

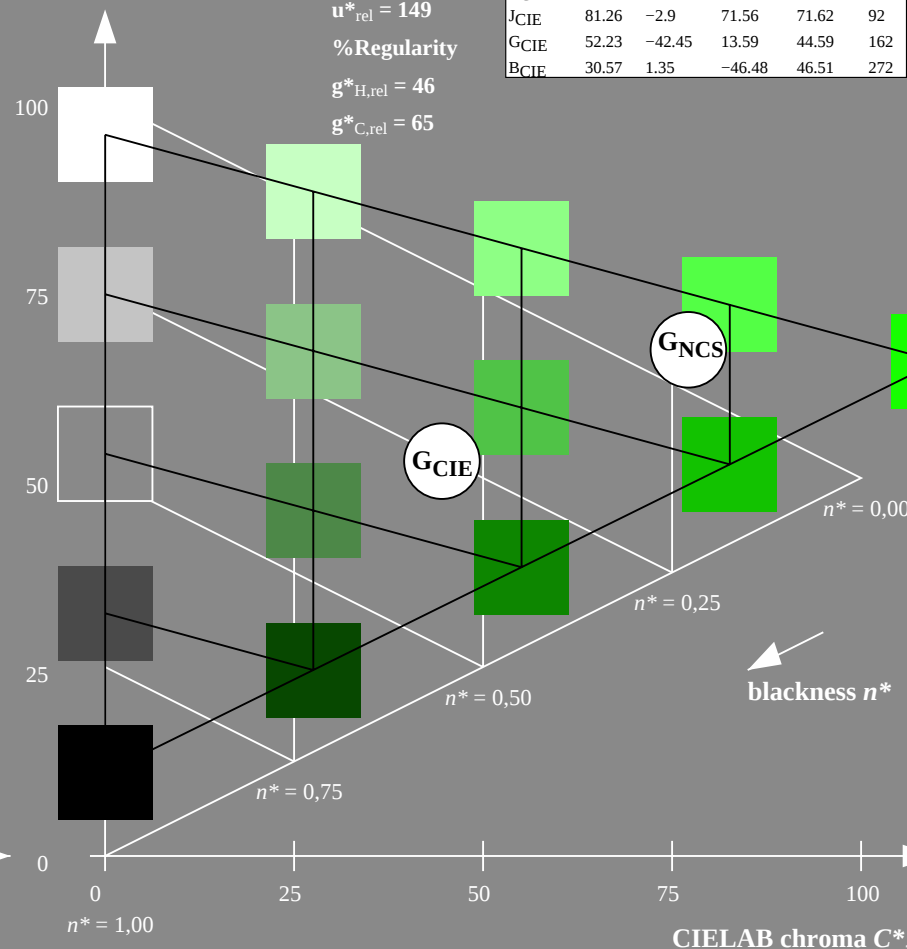

5 step scales for constant CIELAB hue 162/360 = 0.451 (right)

BAM-test chart TE29; Colorimetric systems NCS11a & NCS11a input: $olv^* \cdot setrgbcolor$

D65: Coordinate systems of 5 step colour scales for 10 hues

output: $olv^* \cdot setrgbcolor / w^* \cdot setgray$

