

LMS_F02_L cone sensitivity $\bar{y}_{\max}(\lambda)=1$


$$\bar{s}_{F02_L,1}(\lambda) = B_{31}\bar{x}_{F02_L,1}(\lambda) + B_{32}\bar{y}_{F02_L,1}(\lambda) + B_{33}\bar{z}_{F02_L,1}(\lambda)$$

B_{3j} 0,000 0,000 0,4657 $\lambda=440$

D65: $\Sigma \bar{s}_{F02_L,1}(\lambda) = 21,04$

$x_{F02_L,1} = 0,2240$

$y_{F02_L,1} = 0,2424$

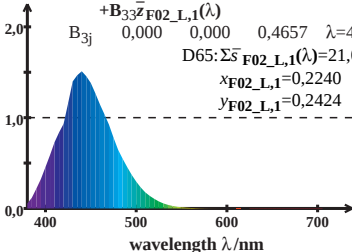

LMS_F02_L cone sensitivity $\bar{y}_{\max}(\lambda)=1$


$$\bar{s}_{F02_L,1}(\lambda) = B_{31}\bar{x}_{F02_L,1}(\lambda) + B_{32}\bar{y}_{F02_L,1}(\lambda) + B_{33}\bar{z}_{F02_L,1}(\lambda)$$

B_{3j} 0,000 0,000 0,5168 $\lambda=440$

D50: $\Sigma \bar{s}_{F02_L,1}(\lambda) = 16,10$

$x_{F02_L,1} = 0,2430$

$y_{F02_L,1} = 0,3009$

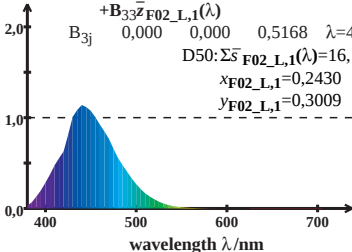

LMS_F02_L cone sensitivity $\bar{y}_{\max}(\lambda)=1$


$$\bar{s}_{F02_L,1}(\lambda) = B_{31}\bar{x}_{F02_L,1}(\lambda) + B_{32}\bar{y}_{F02_L,1}(\lambda) + B_{33}\bar{z}_{F02_L,1}(\lambda)$$

$$B_{3j} \quad 0,000 \quad 0,000 \quad 0,5168 \quad \lambda=440$$

$$P40: \Sigma \bar{s}_{F02_L,1}(\lambda) = 13,20$$

$$x_{F02_L,1} = 0,2808$$

$$y_{F02_L,1} = 0,3253$$

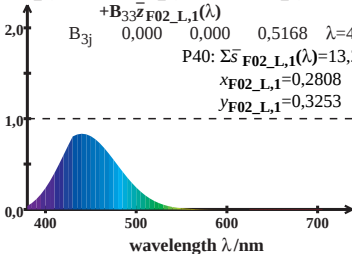

LMS_F02_L cone sensitivity $\bar{y}_{\max}(\lambda)=1$


$$\bar{s}_{F02_L,1}(\lambda) = B_{31}\bar{x}_{F02_L,1}(\lambda) + B_{32}\bar{y}_{F02_L,1}(\lambda) + B_{33}\bar{z}_{F02_L,1}(\lambda)$$

B_{3j} 0,000 0,000 0,5168 $\lambda=440$

$$A00: \Sigma \bar{s}_{F02_L,1}(\lambda) = 7,81$$

$$x_{F02_L,1} = 0,3622$$

$$y_{F02_L,1} = 0,3789$$

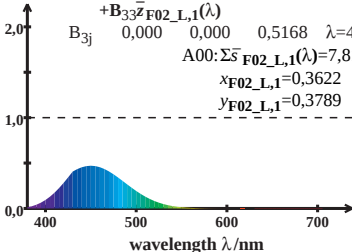

LMS_F02_L cone sensitivity $\bar{y}_{\max}(\lambda)=1$


$$\bar{s}_{F02_L,1}(\lambda) = B_{31}\bar{x}_{F02_L,1}(\lambda) + B_{32}\bar{y}_{F02_L,1}(\lambda) + B_{33}\bar{z}_{F02_L,1}(\lambda)$$

B_{3j} 0,000 0,000 0,5168 $\lambda=440$

E00: $\Sigma \bar{s}_{F02_L,1}(\lambda) = 20,40$

$x_{F02_L,1} = 0,2318$

$y_{F02_L,1} = 0,2682$

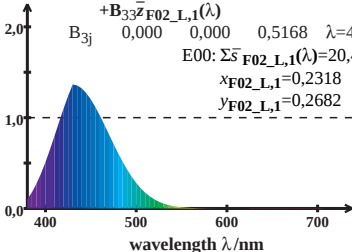

LMS_F02_L cone sensitivity $\bar{y}_{\max}(\lambda)=1$


$$\bar{s}_{F02_L,1}(\lambda) = B_{31}\bar{x}_{F02_L,1}(\lambda) + B_{32}\bar{y}_{F02_L,1}(\lambda) + B_{33}\bar{z}_{F02_L,1}(\lambda)$$

$$B_{3j} \quad 0,000 \quad 0,000 \quad 0,5168 \quad \lambda=440$$

$$C00: \Sigma \bar{s}_{F02_L,1}(\lambda) = 21,90$$

$$x_{F02_L,1} = 0,2114$$

$$y_{F02_L,1} = 0,2530$$

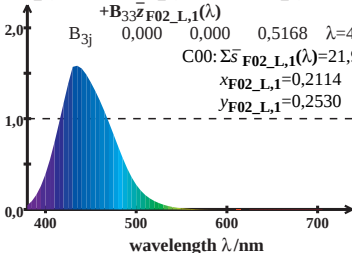

LMS_F02_L cone sensitivity $\bar{y}_{\max}(\lambda)=1$


$$\bar{s}_{F02_L,1}(\lambda) = B_{31}\bar{x}_{F02_L,1}(\lambda) + B_{32}\bar{y}_{F02_L,1}(\lambda) + B_{33}\bar{z}_{F02_L,1}(\lambda)$$

$$B_{3j} \quad 0,000 \quad 0,000 \quad 0,5168 \quad \lambda=440$$

$$P00: \Sigma \bar{s}_{F02_L,1}(\lambda) = 16,72$$

$$x_{F02_L,1} = 0,2594$$

$$y_{F02_L,1} = 0,2945$$

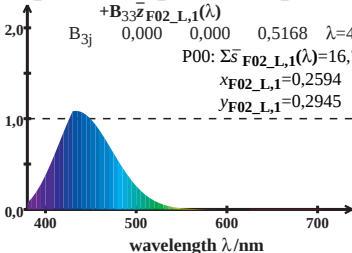

LMS_F02_L cone sensitivity $\bar{y}_{\max}(\lambda)=1$

$$\bar{s}_{F02_L,1}(\lambda) = B_{31}\bar{x}_{F02_L,1}(\lambda) + B_{32}\bar{y}_{F02_L,1}(\lambda) + B_{33}\bar{z}_{F02_L,1}(\lambda)$$

